

Field Test Report

20.5R25 M5UM 2** L5-S SMOOTH ECOMEGA TL




PICTURES UPDATED 26-06-2010

LATEST INSPECTION DATE	18-10-2013	2013	T.P.
------------------------	------------	------	------

Background Info

Customer Reference	CI05718
Country/City	NORTHERN ITALY
Dimension	
Internal number	28615
Operation site	GLASS RECYCLING
Machine Producer	VOLVO
Model	L90F
Tires fitting date	26/03/11
Hours at fitting date	NEW MACHINE - 0

Machine Type

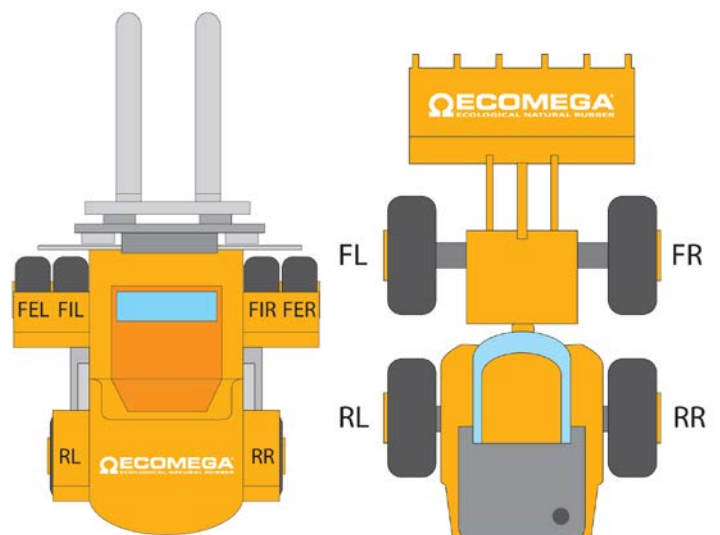



Field Test Report

20.5R25 M5UM 2** L5-S SMOOTH ECOMEGA TL

Test Report

INSP DATE	TIRE POS.	HOURS MONT.	HOURS INSP.	HOURS RUNNING	ORIG. T.D. (mm)	T.D. INTERN (mm)	T.D. EXTERN (mm)	T.D. AVERA GE (mm)	PROJE CTION TO END (hours)	INFL. (bar)
29/05/12	FL	0	2.750	2.750	76	37	38	37,5	5.429	N.A.
	FR	0	2.750	2.750	76	37	39	38	5.500	N.A.
	RL	0	2.750	2.750	76	41	42	41,5	6.058	N.A.
	RR	0	2.750	2.750	76	42	42	42	6.147	N.A.
18/10/13	FL	0	6.100	6.100	76	0	0	0	6.100	N.A.
	FR	0	6.100	6.100	76	1	0	0,5	6.140	N.A.
	RL	0	6.100	6.100	76	12	10	11	7.132	N.A.
	RR	0	6.100	6.100	76	12	11	11,5	7.188	N.A.

FEEDBACK

ECOMEGA M5UM WERE MOUNTED ORIGINAL FITMENT ON NEW MACHINE
TOTAL WORKING HOURS: 6100
TEST CONCLUDED: SUCCESS!

Target to end

ESTIMATED LIFE AT: TEST CONCLUDED 6.100 hours
 DEMOUNTING DATE: 18/10/13
 TOTAL WORKING HOURS: 6.100

Conclusion

TEST CONCLUDED AT 6100 WORKING HOURS: SUCCESS!

Field Test Report

20.5R25 M5UM 2** L5-S SMOOTH ECOMEGA TL

Photo report

